



Superlight LED 3+ 8 888 0.. 110  
8 888 0.. 140  
8 888 0.. 150

Schutzart - Protection IP 67  
Schutzklasse - Safety Class I



## MONTAGE ANLEITUNG MOUNTING INSTRUCTIONS




WILLY MEYER & SOHN GMBH & CO.KG  
LICHTTECHNISCHE SPEZIALFABRIK  
Stemmessiepener Weg 5 • D-58675 Hemer

Anbauleuchte mit 4 Hochleistungs-LED Modulen.

### MONTAGEHINWEISE

Anschluß der Leuchte nach VDE 0100.  
Scheinwerfer für ungeschützte Anlagen.  
Leuchte ist geeignet für die Montage auf normal entflammaren Baustoffen.  
Vor dem Öffnen der Leuchte Netzspannung trennen !  
Leuchte durch Lösen der vier hinteren Schrauben von der Versorgungseinheit nehmen.  
Netzanschlußleitung 10 cm abmanteln und durch die Kabelverschraubung führen, dabei passenden Dichtungssatz (Lieferumfang) wählen.  
Nach dem elektrischen Anschluss Leuchte wieder aufsetzen und Schrauben gleichmäßig über Kreuz anziehen:  
Drehmoment: 3,6 Nm.  
Leuchte ausrichten und Schrauben am Bügel ebenfalls mit 3,6 Nm anziehen.  
Zusätzliche Gewindestifte (A) zur Sicherung der eingestellten Ausrichtung mit 3,6 Nm anziehen.  
Das Glas ist ein Einscheiben-Sicherheits-Hartglas.




Die Leuchte darf nur mit ihren vollständigen Schutzabdeckungen betrieben werden.

Leuchte	Gewicht	Windangriffsfläche
8 888 0.. ...	8,9 kg	0,08 m <sup>2</sup>



Die in dieser Leuchte eingebaute Lichtquelle darf nur durch den Hersteller oder seinen Kundendienst oder eine ähnlich qualifizierte Person ersetzt werden.


In Strahlrichtung den Mindestabstand zu angestrahlten Flächen einhalten !



Luminaire with 4 high performance LED modules.

### MOUNTING INSTRUCTIONS

Connection of light fitting in compliance with the prevailing regulations in your country.  
Luminaire for non-protected outdoor installation.  
Luminaire is suitable for mounting on normal inflammable surfaces.  
Disconnect from power supply before opening light fitting.  
Remove luminaire from control gear unit by loosening the 4 screws on the back.  
Remove the sheathing from the last 10 cm of cable and pass cable through cable gland.  
Take care to use the correct gasket to suit the diameter of cable being used. Set of gaskets supplied with luminaire. After making the electrical connection, replace the luminaire and tighten the 4 screws evenly and crosswise. Torque: 3.6 Nm.  
Aim luminaire and tighten the screws in the mounting bracket with 3.6 Nm.  
Additional grub screws (A) should be tightened with 3.6 Nm torque to ensure that aimed position is maintained. The glass is tempered safety glass.




Luminaire may be operated only if all protective covers are in place.

Part number	Weight	Projected area
8 888 0.. ...	8.9 kg	0.08 m <sup>2</sup>



The light source contained in this luminaire shall only be replaced by the manufacturer or his service agent or a similar qualified person.

Ensure that the minimum distance between luminaire and illuminated surface is observed.



### Maximale Belastung von Leitungsschutzautomaten / Maximum loading of automatic circuit breakers


Einschaltstrom: 62 A

Sicherungsautomat / automatic circuit breaker type:

Kabelquerschnitt [mm<sup>2</sup>] / cable cross section [mm<sup>2</sup>]:

Anzahl Leuchten / number of luminaires:

	B10	B16	B25
1,5	1,5	1,5	1,5
4	8	14	

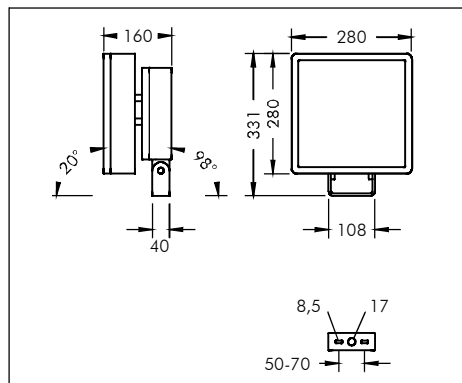

8 888 0.. 150